Appendix F USB Recovery for IWH3216 Touch II


1. Plug the USB pen drive on a PC (PC could be any PC as long as has a CD-ROM drive and USB port).


- The USB pen drive must have 4G ~ 16G capacity in order to store the recovery file.
- In Windows 7 system, please disable **UAC** function before make the recovery file.
- In Windows XP system, please login as an **administrator** authorization level.

2. Insert the software CD into the DVD-ROM drive of PC.
3. Click **USB Recovery** on auto run screen.



4. Select the USB pen drive in **Device** and click **Start** button.

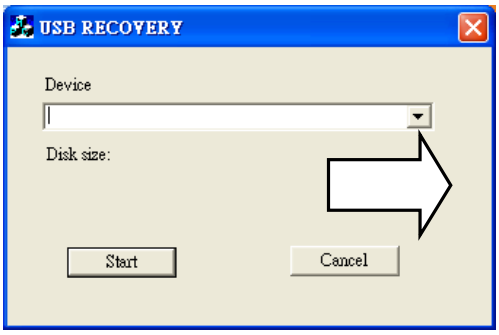

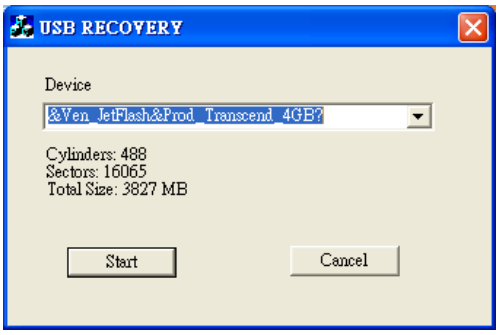


5. USB pen drive will be formatted. Click **Yes** to accept the formatting of USB pen drive.


In Windows 7 system, the system will do the formatting twice.

---

6. After format is completed, the recovery files will copy into the USB pen drive. When the copy process is completed, click **OK** to finish.

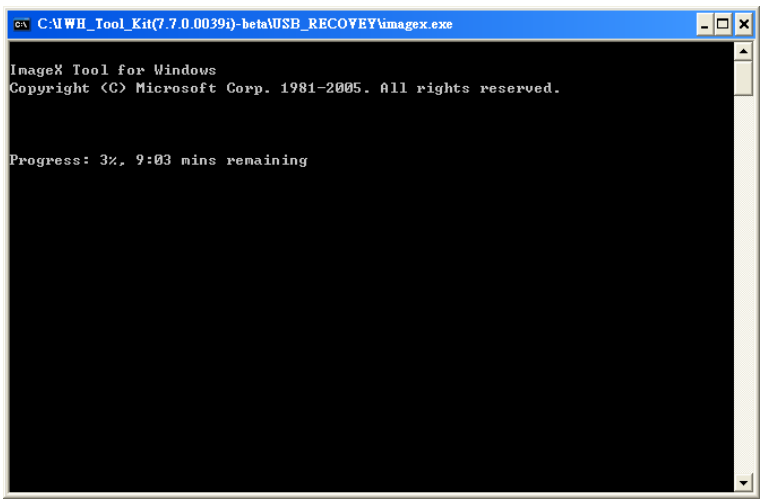


7. And then, un-plug the USB pen drive from the PC and plug into the DVR unit.
8. Restart DVR unit (power off and power on) and press **F11** button on keyboard.
9. Select the boot device as **USB** and press **Enter** button.

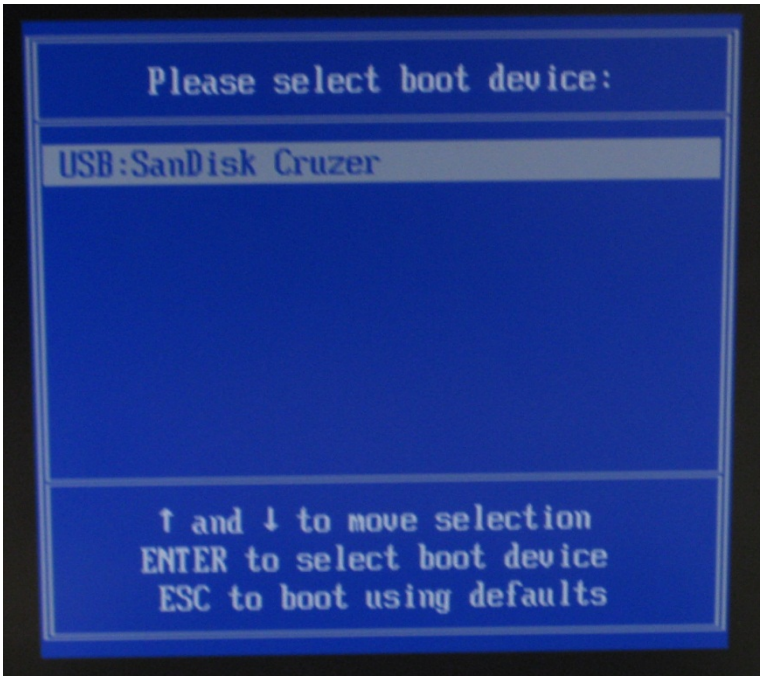


10. The DVR system will start the recovery action.


The prepare screen may be varied that it depends the Windows system that user has used to ma
recovery file.

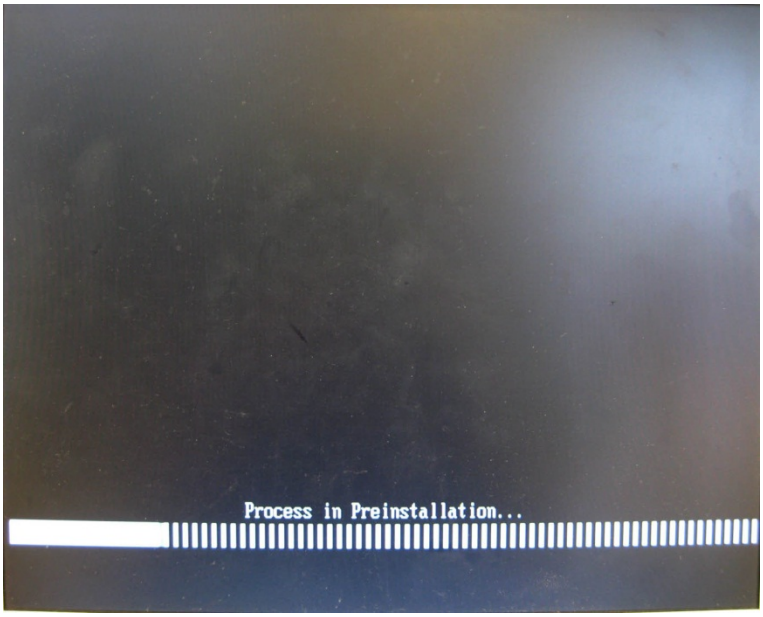


11. When **Recovery Tool Kit** window appears, click **Recovery System**.

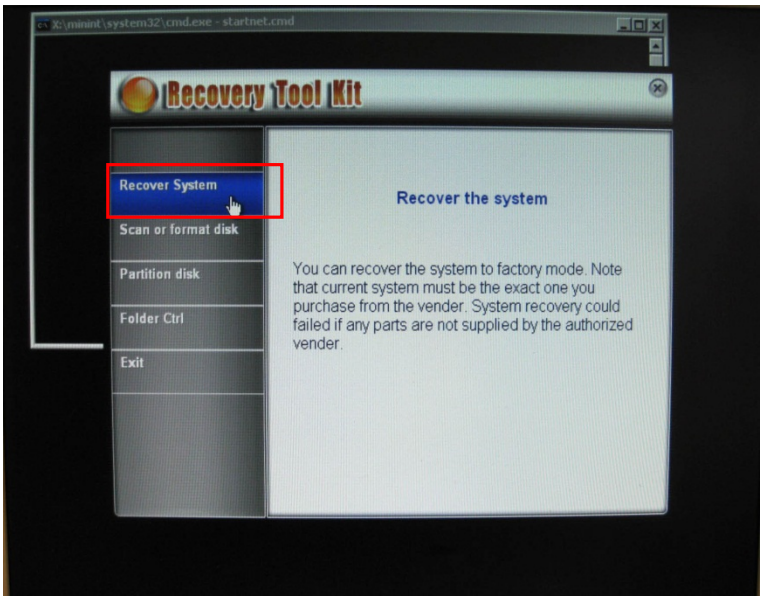


12. The **System Recovery Wizard** will show up, click **Next** to continue.

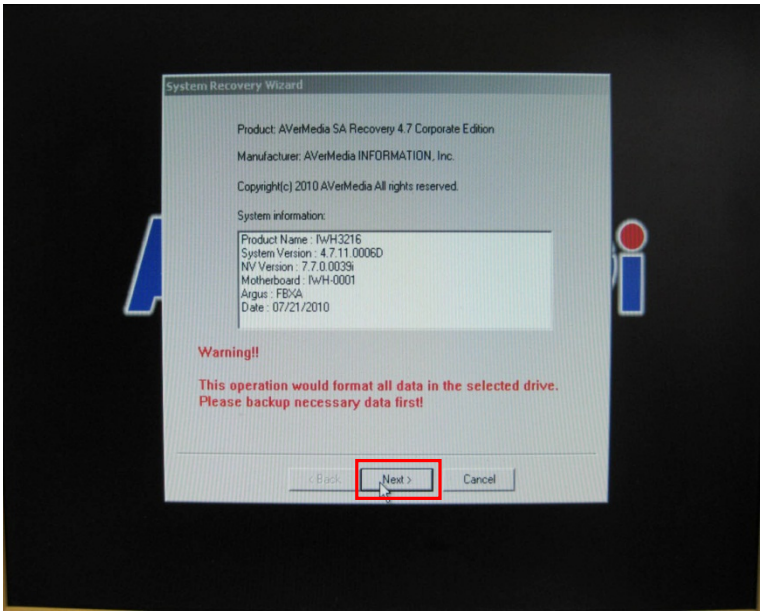


13. Select the recovery target. And then, click **Next**.

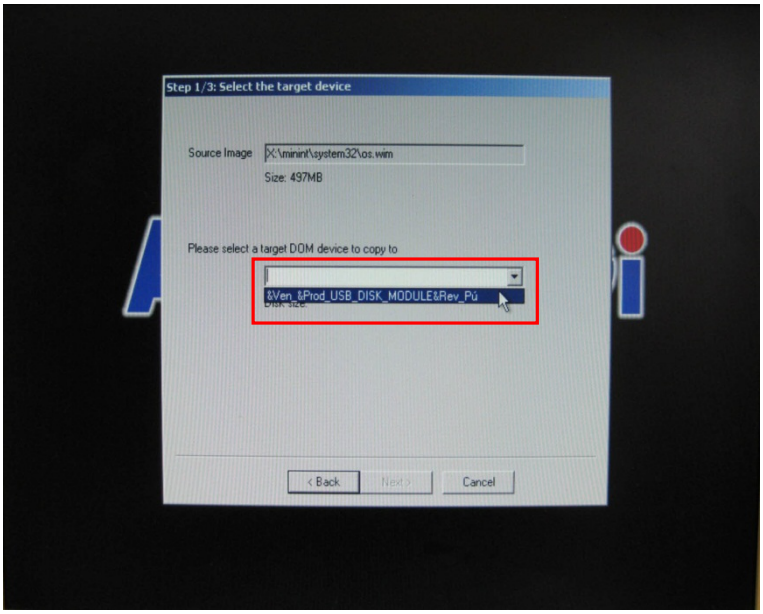

Step 1/3: Select the target device
Source Image
X:\minint\system32\os.wim
Size: 497MB
Please select a target DOM device to copy to
&Ven_&Prod_USB_DISK_MODULE&Rev_Pú
< Back
Next >
Cancel

14. Click **Yes** to confirm the selection. If user wants to change the recovery target, click **NO** and select another recovery target.

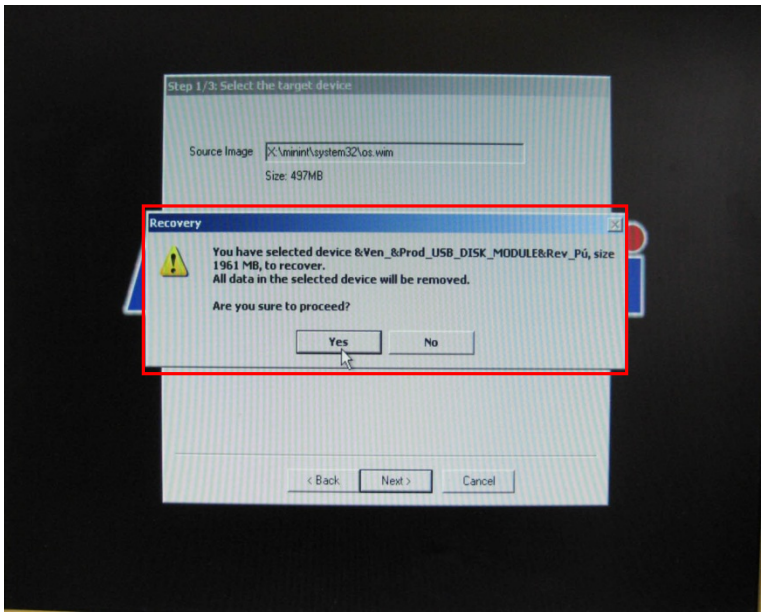


15. And then, the recovery process will start. It takes about 50minutes to complete. If user wants to stop the recovery process, click **Abort** button.

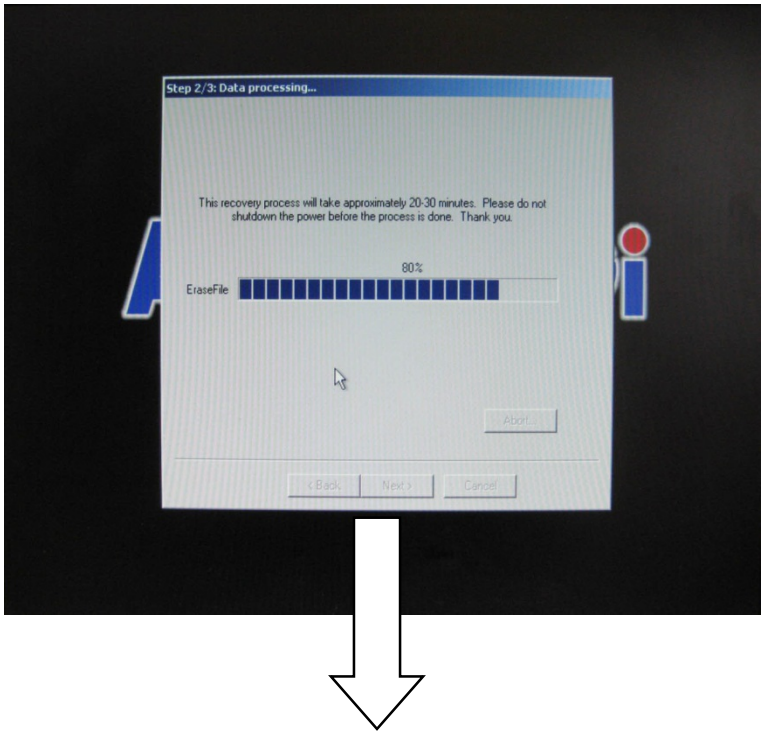

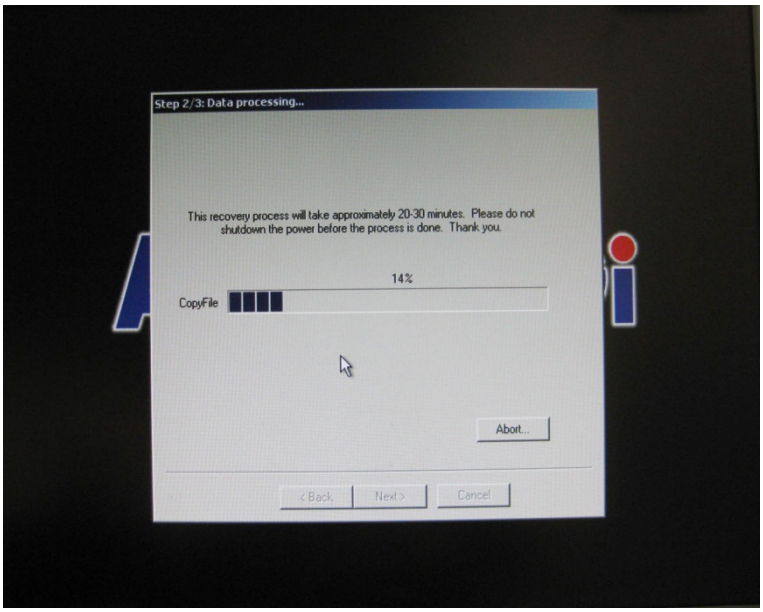
Step 2/3: Data processing...
This recovery process will take approximately 20-30 minutes. Please do not shutdown the power before the process is done. Thank you.
14%
CopyFile
Abort...
< Back
Next >
Cancel

16. When completed massage window show up, the recovery process is completed. Click **Exit** to leave the System Recovery Wizard window.

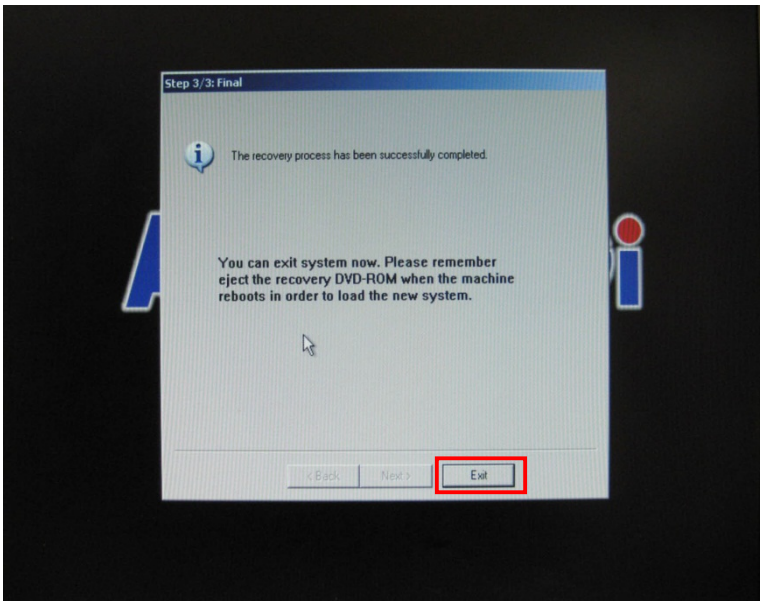

17. In Recovery Tool Kit window, click **Exit** to remove the recovery CD-ROM and reboot the DVR system.

